

**DEXTERI+**
Wellfit

(*) Add the size : 07 to 12

FIELD OF USE

Personal protection against electrical shocks for live working from 500 V AC to 36 000 V AC (class 00 to class 4).

These gloves have to be used with leather over gloves, to ensure a mechanical protection.

The use of thin cotton under gloves is recommended for a better comfort and a good hygiene.

CHARACTERISTICS

- Insulating gloves from class 00 (500 V AC) to class 4 (36 000 V AC)
- **Wellfit finish:** improved comfort of use thanks to a softer and suppler finish enhancing the dexterity
- Material : natural rubber
- Temperature of use : -25°C to +55°C
- Type : 1 (non-resistant to ozone)
- Colour : Black for class 00 and 0, Bi-colour for class 1 to 4 (external black and internal natural)
- Gloves marking following ASTM D 120 – 09
- Colour label for each class
- Flash code for traceability : direct access to the test report
- Delivered in individual packaging, this packaging provides UV protection

STANDARD

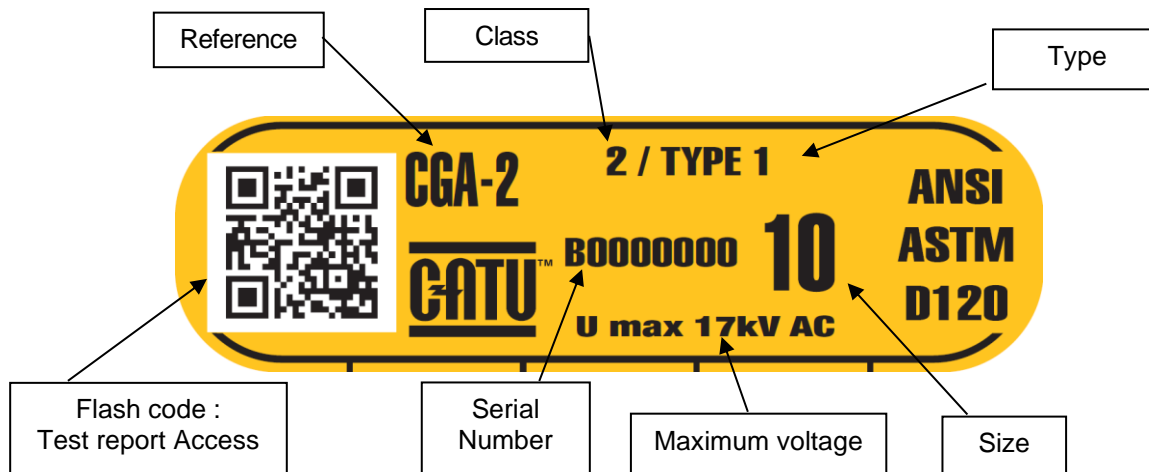
- ASTM D 120 – 09

RANGE

References	Class	Type	Label	Voltage max	
				AC	DC
CGA-00-*-B	00	1	beige	500	750
CGA-0-*-B	0	1	Red	1 000	1 500
CGA-00-*-R	00	1	beige	500	750
CGA-0-*-R	0	1	Red	1 000	1 500
CGA-1-*-NB	1	1	White	7 500	11 250
CGA-2-*- NB	2	1	Yellow	17 000	25 500
CGA-3-*- NB	3	1	Green	26 500	39 750
CGA-4-*- NB	4	1	Orange	36 000	54 000
CGA-1-*-NR	1	1	White	7 500	11 250
CGA-2-*- NR	2	1	Yellow	17 000	25 500
CGA-3-*- NR	3	1	Green	26 500	39 750
CGA-4-*- NR	4	1	Orange	36 000	54 000

(*) Add the size : 07 to 12

(**) Add the size : 09 to 12

B = Black
R = Red
NB= Internal natural, external Black
NR = Internal natural, external Red
ASTM LABEL


DIMENSIONS (mm)

References	Length (1) (Inch)	Nominal Thickness (mm)
CGA-00-*-B	14	0.70
CGA-0-*-B	14	0.92
CGA-00-*-R	14	0.70
CGA-0-*-R	14	0.92
CGA-1-*-NB	14	1.41
CGA-2-*-NB	14	2.28
CGA-3**-NB	14	2.73
CGA-4**-NB	16	3.15
CGA-1-*-NR	14	1.41
CGA-2-*-NR	14	2.28
CGA-3**-NR	14	2.73
CGA-4**-NR	16	3.15

(1) Other length on request

PACKAGING

The insulating gloves are delivered in an individual cardboard :



ACCESSORIES (Option)



Cotton under-gloves CG-80



Cotton mittens CG-81



Pneumatic gloves tester CG-117



Gloves box CG-35/2

Over-gloves CG-991
For class 1 to 4Over-gloves CG-981
for class 00 or 0

STORAGE RECOMMENDATION :

Gloves should be stored in their container or package. Care should be taken to ensure that gloves are not compressed, folded or stored in proximity to steam pipes, radiators or other sources of artificial heat or exposed to direct sunlight, artificial light or other source of ozone. It is desirable that the ambient temperature be between 10°C and 21°C.